



Centurion Office Park  
Block A 2nd floor  
cnr Embankment & Hendrik Verwoerd Drive  
Centurion  
PO Box 7106 Centurion 0046  
Republic of South Africa  
Tel: +27 12 674 7100  
Fax: +27 12 663 5513  
e-mail: nnr@nnr.co.za

**Enquiries:** T Pather  
**Our reference:** NIL29B0001  
**Your reference:**

04 August 2010

Chief Executive Officer  
Necsa  
P O Box 582  
PRETORIA  
0001

**FOR THE ATTENTION OF DR RM ADAM**

Dear Dr Adam

**NUCLEAR INSTALLATION LICENCE NIL-29 (VARIATION 0)**

1. Please find enclosed one controlled copy of Nuclear Installation Licence No. NIL-29 (Variation 0), being the nuclear authorisation issued to Necsa for the operation of Area 26. This document must be controlled in accordance with the Necsa arrangements for controlled documents.
2. The provisions of Nuclear Licence NL27 (Variation 25) are no longer applicable to Area 26.
3. The issue of Nuclear Installation Licence No. NIL-29 (Variation 0) –
  - i. Gives effect to the Minister's ruling that separate authorisations be issued for the nuclear installations on the Pelindaba site.
  - ii. Provides a description of the installation, a clear definition of the scope of actions that may be undertaken by the installation and the associated NNR specified requirements.
4. With the above-mentioned authorisation now issued to Necsa, please be advised that the format for correspondence between **Necsa and the NNR on Area 26** will be as follows:
  - i. Correspondence **from Necsa to the NNR**: NIL29AXXXX, where "XXXX" is sequential numbers starting with 0001.
  - ii. **Correspondence from the NNR to Necsa**: NIL29BXXXX, where "XXXX" is sequential numbers starting with 0001.
  - iii. **NNR Authorisation Requests (NAR's)** will be numbered as follows: NIL29-NAR-XXXX, where "XXXX" is sequential numbers starting with 0001.

2.

NIL29B0001

- iv. **Authorisation Change Requests (ACR's)** will be numbered as follows: NIL29-ACR-XXXX, where "XXXX" is sequential numbers starting with 0001.
- v. **Events** will be numbered as follows: NIL29-OCC-XXXX, where "XXXX" is sequential numbers starting with 0001.
- vi. Necsa is required to follow this numbering system with immediate effect.

5. The issue of this nuclear authorisation does not relieve Necsa of any obligations under any other legislation.

Yours faithfully



Adv BM Mkhize  
**CHIEF EXECUTIVE OFFICER**



## NUCLEAR INSTALLATION LICENCE No. NIL-29 (Variation 0)

Nuclear Installation Licence No. NIL-29 (Variation 0) issued in terms of the provisions of Section 23 of the National Nuclear Regulator Act, Act 47 of 1999 (hereinafter referred to as the Act)

to

THE SOUTH AFRICAN NUCLEAR ENERGY CORPORATION (Necsa)  
(hereinafter referred to as the Licensee)

for


the operation of **Area 26** on the farm Weldaba 567 JQ (formerly Welgegund 491 JQ), in the magisterial district of Brits in the North West Province, known as the Pelindaba site. The site referred to in this licence refers to the defined portion of the Pelindaba site on which Area 26 is constructed (see Figure 1).

The Nuclear Installation Licence is not transferable and is effective from the date of issue, subject to adherence with –

- (i) the Conditions of Authorisation in PART A; and
- (ii) the Specified NNR Requirements in PART B.

Issued at Centurion on this 5<sup>th</sup> day of August 2010

  
\_\_\_\_\_  
CHIEF EXECUTIVE OFFICER

	<p style="text-align: center;"><b>NUCLEAR INSTALLATION LICENCE No. NIL-29 (VARIATION 0)</b></p>	<p style="text-align: right;"><b>Page 2 of 27</b></p>
---	---	---

## **PART A: CONDITIONS OF AUTHORISATION**

### **1. General**

- a. In these conditions any reference to an agreement, approval, directive, specification, notification, process or any formal communication between the NNR and the licensee, and vice versa, shall be deemed to be a reference to a written document.
- b. In these conditions any reference to approved processes and or procedures shall be deemed to be licensee processes and or procedures.
- c. In these conditions any reference to NNR approved processes and or procedures shall be deemed to be licensee processes and or procedures that have been reviewed and approved by the NNR.
- d. The licensee must ensure that once approved no alteration or amendment is made to the NNR approved processes and or procedures unless the NNR has approved the said alteration or amendment.
- e. Where in these conditions, the NNR requires any matter to be approved or to be carried out only with its consent or to be carried out as it directs, the NNR may –
  - i. from time to time modify, revise or withdraw, either wholly or in part, any such approval, directive or consent;
  - ii. approve, either wholly or in part, any modification or revision or any proposed modification or revision to any matter for the period being approved.
- f. The English text of the licence is the official text of the licence.

### **2. Facility Description**

**Area 26** is situated on the eastern side of the Pelindaba site and is adjacent to the Area 14 Waste Management Facility and is a single floor concrete building structure with a floor area measuring 4788 m<sup>2</sup>. Area 26 has an airlock in the eastern wall of the facility that connects it to the Area 14 Waste Management Facility and an airlock in the north western corner that links to Area 40 and Area 24.

This area was previously used as a maintenance area for the previous enrichment plant (Z-Plant).

BM



Area 26 consists of the following areas/facilities:

- The **Test Smelter**.
- The **Area 26 Cutting Facility**.
- The **Area 26 Sorting Area**.
- The **Safeguards Store**.
- **Area 26 Process Floor**
- **Area 26 Storage Area**
- **Workshop 1 in Area 26**
- **Workshop 2 in Area 26**

a. **Test Smelter**

The Test Smelter is housed in the south west corner of Area 26 and is a 100kW induction furnace with cooling, ventilation and filter units. The Test Smelter is contained within a bund of sufficient capacity to contain a full smelt charge.

Melt feedstock, waste and ingots awaiting results of analysis may be stored in a demarcated area in the Test Smelter area.

b. **The Area 26 Cutting Facility**

The Area 26 Cutting Facility is situated against the western wall of Area 26 and is equipped with a local and a workplace extraction ventilation.

The Area 26 Cutting Facility consists of an 8m x 8.2m x 6.5m high room with two full length (6.7m x 1.75m) doors.

The facility is used for the dismantling and cutting of large radiologically contaminated equipment or components to facilitate their decontamination.

c. **The Area 26 Sorting Area**

The Area 26 Sorting Area is situated in the south eastern corner of Area 26 adjacent the Test Smelter.

The Area 26 Sorting Area is used for the sorting of equipment and components from the decommissioning of nuclear facilities into material categories destined for smelting.

d. **The Safeguards Store in Area 26**

The Safeguards Store in Area 26 is situated to the north of the Test Smelter against the western wall of Area 26.

BM



This store is used for the storage, in ISO Containers, of material that is subject to IAEA Safeguards.

e. **Area 26 Process Floor**

The Area 26 process floor is the area in the middle of Area 26 which is used for the storage of electric motors components.

f. **Area 26 Storage Area**

The Area 26 Storage Area is situated against the Eastern wall of Area 26 and to the north of the airlock between Area 14 and Area 26.

The Area 26 Storage Area is utilised for the storage of items and components originating from the decommissioning of the previous Z-Plant.

g. **Workshop 1 in Area 26**

Workshop 1 in Area 26 is situated in the north eastern corner of Area 26 and is currently not in use.

h. **Workshop 2 in Area 26**

Workshop 2 in Area 26 is situated in the north eastern corner of Area 26 and to the south of Workshop 1 and is currently not in use.

### 3. Scope of Actions that may be undertaken by the Installation

a. The **Test Smelter** is authorised for the following activities –

- i. Construction and cold commissioning.
- ii. The receiving of non-contaminated scrap to be used in the cold commissioning of the Test Smelter.
- iii. Storage of non-contaminated:
  1. Components and equipment.
  2. Feed material for the Test Smelter in a dedicated demarcated block with dimensions of 3m x 4m.
  3. Metal ingot, slag, fluxes and ladle lining.

b. The **Area 26 Cutting Facility** is authorised for the following activities –

- i. Receiving of equipment to be cut in the Area 26 Cutting Facility.
- ii. Storage of equipment to be cut in the Area 26 Cutting Facility in the Area 26 Cutting Facility storage area.
- iii. Hot or Cold cutting of contaminated components.

c. The **Area 26 Sorting Area** is authorised for the following activities –

- i. The sorting of contaminated items and components destined for the Test Smelter.

BM



- d. The **Storage Area for IAEA Safeguards material** in Area 26 is authorised for the following activities –
- Storage of the ISO Containers containing equipment under IAEA safeguards pending investigation.
- e. The **Area 26 Process Floor** is authorised for the following activities –
- Storage of electrical motor windings destined for melting in Area 26.
- f. The **Storage Area in Area 26** is authorised for the following activities –
- The storage of items and components originating from the decommissioning of the previous Z-Plant.
- g. **Workshop 1 in Area 26** is authorised for the following activities –
- This Workshop is currently not in use.
  - Care and Maintenance activities limited to inspections, radiological protection surveillance monitoring, maintenance and housekeeping;
- h. **Workshop 2 in Area 26** is authorised for the following activities –
- This Workshop is currently not in use.
  - Care and Maintenance activities limited to inspections, radiological protection surveillance monitoring, maintenance and housekeeping;

#### 4. Demarcation of Site Boundary, Site Plans, Designs and Specifications

- The licensee must maintain a plan of the site (hereinafter called the site plan) showing the location of the boundary of the site and every building, plant or facility on the site.
- The licensee must demarcate the boundaries of the site by fences or other appropriate means and all such fences or other means used for this purpose must be properly maintained.
- Prior to making any change to the site, which impacts or has the potential to impact on health, safety, or the environment as contemplated in the Act, the licensee must submit to the NNR an amended site plan and schedule, for approval.
- The licensee must submit, to the NNR, such plans, diagrams, designs, specifications, or other information relating to the buildings, plants or any other facilities on the site as the NNR may specify.

BM



## 5. Physical Security

- a. The licensee must ensure the safety and security of the –
  - i. site; and
  - ii. all installations and persons thereon,
- b. The physical protection system must be designed to protect against the design basis threat, theft or diversion of radioactive material and sabotage.
- c. The licensee must prevent unauthorised persons from entering the site or any part thereof.

## 6. Transport

- a. The transportation of radioactive material or any equipment or objects contaminated with radioactive material must be carried out in compliance with the relevant provisions of the International Atomic Energy Agency's Regulations for the Safe Transport of Radioactive Material, 2005 Edition, IAEA Safety Standard Series No. TS-R-1, IAEA, Vienna, 2005.
- b. The licensee must ensure that no radioactive material is brought onto the site or conveyed from the site, except in accordance with processes approved by the NNR.
- c. All on site transport of radioactive material or any equipment or objects contaminated with radioactive material must be carried out in compliance with processes approved by the NNR.
- d. The licensee must keep a record of all radioactive material consigned to and from the site. Such record must –
  - i. contain particulars of the amount, type and form of such radioactive material, the manner in which it was packaged, the name and address of the person to whom it was consigned to or from and the date when it left or arrived on the site.
  - ii. be preserved for a period acceptable to the NNR.
- e. The licensee must not undertake any transport of radioactive material to sites, installations or persons not appropriately authorised to receive such material.

BM



## 7. Restrictions on Dealing with the Site

- a. The licensee may not lease, assign, or grant possession to use –
  - i. the site, or any portion thereof; or
  - ii. any radioactive material,to any person not in possession of an appropriate nuclear authorisation, where such an authorisation is required.
- b. The licensee must inform the NNR in writing of such intention and request the revocation or amendment of the relevant part of the authorisation as appropriate.
- c. The licensee remains responsible for compliance with all conditions of authorisation until such time as said conditions are revoked or amended.
- d. The licensee must prevent persons from carrying out any unauthorised actions on the site.
- e. The licensee must ensure that no radioactive material intended for use in connection with any new installation, process or modification to the existing installation is brought onto site for the first time without consent of the NNR.
- f. The licensee must ensure that no radioactive material is stored on the site except in accordance with processes approved by the NNR.
- g. The licensee must ensure that every person authorised to be on the site receives instructions (to the extent that this is necessary having regard to the circumstances of that person being on the site) as regards the risks and hazards associated with the nuclear installations and their operation, the precautions to be observed in connection therewith and the actions to be taken in the event of an accident or emergency on the site.
- h. The licensee must implement approved processes for suitable training of all persons who have responsibilities for any operations which may affect safety.
- i. The licensee must ensure that suitable and sufficient methods are employed on the site for the purposes of informing persons thereon of each of the following matters –
  - i. the meaning of any warning sign used on the site;
  - ii. the location of any exit from any place on the site, where such exit is provided for use in the event of an emergency;
  - iii. the measures to be taken by such persons in the event of any emergency.

BM



## 8. Radiological Protection

- a. The licensee must implement the approved processes for the purposes of ensuring radiological protection of employees, members of the public and the environment, both on the site and off the site, as a consequence of authorised actions.
- b. The normal operational exposure of individuals must be restricted to ensure that neither the effective dose nor the equivalent dose to relevant organs or tissues exceeds any relevant dose limit specified by the NNR.
- c. The licensee's radiological protection processes must, under all operating states of the authorised actions or facilities ensure that—
  - (i) effective radiation doses, including committed effective doses, to persons;
  - (ii) the number of people who are exposed, and
  - (iii) the likelihood of incurring exposures to radiation, are kept as low as reasonably achievable.
- d. A dose register of every occupationally exposed worker must be established and maintained in a form acceptable to the NNR. The licensee must retain the register for a period of at least fifty years from the date of last entry.
- e. The licensee must implement NNR approved processes for the purposes of control of radioactive sources.

## 9. Medical Surveillance and Health Register

- a. A comprehensive medical surveillance programme and health register must be maintained in a form approved by the NNR.
- b. All entries in the health register must be made by an appointed medical practitioner or a person so authorised.
- c. The appointed medical practitioner must inform the employee of any medical condition, which could have arisen as a result of occupational exposure to radiation.
- d. The licensee must retain the register for a period of at least fifty years from the date of last entry.
- e. An employee or former employee must have right of access to his medical records and health register at all times.

BM



## 10. Radioactive Waste Management

- a. The licensee must implement NNR approved processes for the minimisation and safe management of radioactive waste on the site.
- b. The radioactive waste management programme must –
  - i. ensure the identification, quantification, characterisation and classification of any radioactive waste generated;
  - ii. provide for the necessary steps leading to safe clearance, authorised discharge, disposal, reuse or recycling; and
  - iii. provide for the safe storage of radioactive waste between any waste management processes.
- c. The safety of radioactive waste storage options must be assured for the envisaged period of storage.

## 11. Documents, Records, Authorities and Certificates

- a. The licensee must keep adequate records to demonstrate compliance with the conditions of this licence.
- b. The licensee must implement and maintain an approved document management system to ensure that every document required, every record made, every authority, consent or approval granted and every directive or certificate issued in pursuance of these conditions of licence is preserved for 30 years or such other period as the NNR may approve.
- c. Operational reports must be submitted to the NNR at predetermined periods, approved by the NNR, and must contain such information as the NNR may require on the basis of the nuclear installation's safety assessment.

## 12. Events, (including Incidents or Accidents) on the Site

- a. The licensee must implement NNR approved processes for the notification, recording, investigation and reporting and closeout of events (incidents, accidents, etc.) occurring on the site –
  - i. in accordance with requirements specified by the NNR;
  - ii. as required by any other condition attached to this licence; or
  - iii. as the licensee considers necessary.

BM



### 13. Emergency Planning and Preparedness

- a. The licensee must implement NNR approved processes related to preparedness for and response to any event, (incident, accident, etc) or other emergency arising on the site and their associated impacts.
- b. The licensee must ensure that such processes include procedures to ensure that all persons, in the employ of the licensee, who have duties in connection with such processes are properly trained and instructed in –
  - i. the performance of the processes;
  - ii. the use of any equipment that may be required; and
  - iii. the precautions to be observed.
- c. Where such processes require the assistance or cooperation of, or it is expedient to make use of the services of any person, local authority or any other body; the licensee must ensure that such persons, local authority or other body are consulted in the periodic review and update of such processes.
- d. The licensee must ensure that all such processes are exercised and tested at such intervals and at such times and to such extent as the NNR may specify or, where the NNR has not so specified, as the licensee considers necessary to ensure their continued viability.

### 14. Environmental Protection

- a. The licensee must implement NNR approved processes for the protection of public health and the environment arising from the nuclear installation's authorised activities.
- b. The licensee must ensure that no radioactive effluent release is made from the site except in accordance with procedures and processes approved by the NNR.
- c. The licensee must implement NNR approved processes and procedures for environmental monitoring and surveillance.

### 15. Duly Authorised and Suitably Qualified and Experienced Persons

- a. The licensee must implement NNR approved processes and procedures for ensuring that only suitably qualified and experienced persons perform any

BM.



duties, which may affect the safety of operations on the site, or any duties assigned by or under these conditions of licence.

- b. Such processes and procedures must make provision for the appointment, as appropriate, of duly authorised persons to control and supervise operations, which may affect plant or facility safety.

### 16. Safety Committee

- a. The licensee must implement processes and procedures relating to safety committee(s) to oversee and manage its safety responsibilities and to which it refers for consideration and advice –
  - i. matters required by or under this licence;
  - ii. safety policies, procedures, processes or documents required by these conditions of licence or as the NNR may specify and any subsequent alteration or amendment to said processes or documents;
  - iii. any matter affecting safety on or off the site which the NNR may specify; and
  - iv. any other matter, which the licensee considers should be referred to a safety committee.
- b. The terms of reference of any such safety committee must be submitted to the NNR.
- c. The licensee must ensure that the members of any such committee are suitably qualified and experienced, so as to enable said committee to consider any matter likely to be referred to it and to advise the licensee authoritatively and, so far as practicable, independently.
- d. The licensee must ensure that a safety committee shall consider or advise only during the course of a properly constituted meeting of that committee. Minutes must be kept of all such meetings

### 17. Safety Documentation

- a. The licensee must implement NNR approved processes and procedures for the production and assessment of safety cases consisting of documentation to justify safety during the following lifecycle phases of the installation –
  - i. Siting;
  - ii. Design;
  - iii. Manufacture of component parts;
  - iv. Construction;

BM.



- v. Commissioning;
  - vi. Operation;
  - vii. Termination of operation;
  - viii. Decontamination; and
  - ix. Decommissioning.
- b. The safety case must include a risk assessment and demonstration of compliance with the Regulations on Safety Standards and Regulatory Practices as well as any other requirements and guidance prescribed by the NNR.
- c. The licensee must establish and implement processes for the periodic and systematic review and reassessment of safety cases.
- d. The licensee must if so directed by the NNR, carry out a review and reassessment of safety and submit a report of said review and reassessment to the NNR at such intervals within such period and for such matters or operations as may be specified in the directive.

### 18. Quality and Safety Management

- a. Quality and Safety Management processes and procedures must be established implemented and maintained in respect of all matters that may affect safety in order to ensure compliance with the conditions of this licence.
- b. The licensee must comply with all NNR approved or NNR accepted documents contained in the Necsca Process Based Licensing (PBL) Manual.
- c. The licensee must submit to the NNR such copies of records or documents made in connection with the aforementioned processes and procedures as the NNR may specify.

### 19. Modification to Design of Existing Plant or Facility

- a. The licensee must comply with NNR approved processes and procedures relating to control of modification to the design of existing plant, facility or system design including modifications that may be of a temporary nature.

BM.



- b. The aforesaid processes must provide for the classification of modifications according to their safety significance.
- c. Where appropriate modifications must be divided into stages and where the NNR has so specified the licensee must not commence nor thereafter proceed from one stage to the next of the modification without the prior approval of the NNR.
- d. The processes must include a requirement for the provision of adequate documentation to justify the safety of the proposed modification and shall where appropriate provide for the submission of such documentation to the NNR.

## 20. Construction and Commissioning of Plant or Process

- a. The licensee must implement NNR approved processes and procedures relating to the construction and commissioning of any plant, facility or process.
- b. Where appropriate, construction and commissioning of the plant or process may be divided into stages. If so specified by the NNR, the licensee must not commence with any stage nor proceed from one stage of the construction or commissioning to the next without the prior approval of the NNR.

## 21. Limits and Conditions on Operations

- a. The licensee must, in respect of any operation that may affect safety, produce a safety case to demonstrate the safety of the operation and identify the limits and conditions necessary in the interest of safety. The limits and conditions of operation must be submitted to the NNR for approval.
- b. The licensee must ensure that operations are controlled and carried out in compliance with NNR approved limits and conditions on operations at all times.
- c. Where the person appointed in terms of paragraph 15 (a) identifies any matter indicating that the safety of any operation or the safe condition of any plant is compromised, that person must bring it to the attention of the relevant facility management, who must forthwith take appropriate action

BM.



to ensure that the matter is appropriately notified, recorded, investigated and reported to the NNR.

- d. The NNR may in the interests of safety, at any time revoke, amend or impose any limiting condition on operations.

## 22. Examination, Inspection, Maintenance and Testing

- a. The licensee must implement NNR approved processes for the regular, periodic and systematic examination, inspection, maintenance and testing of all plant, systems, structures and components, including software.
- b. The aforesaid processes must provide for the preparation of a plant maintenance schedule for each plant or facility. The licensee must submit to the NNR for its approval, such part or parts of any plant maintenance schedule as the NNR may specify.
- c. The licensee must ensure that a full and accurate report of every examination, inspection, maintenance or test, of any part of a plant, system, structure or component, indicating the date thereof and signed by a suitably qualified and experienced person appointed by the licensee, is made.
- d. The licensee must ensure, in the interests of safety, that examination, inspection, maintenance and test of a plant or any part thereof is carried out –
  - i. only by suitably qualified and experienced persons;
  - ii. in accordance with written procedures;
  - iii. within the intervals specified in the plant maintenance schedule; and
  - iv. under the control and general supervision of a suitably qualified and experienced person appointed by the licensee for that purpose.
- e. When any examination, inspection, maintenance or test of any part of a plant reveals any matter indicating that the safe operation or safe condition of that plant may be affected, the suitably qualified and experienced person appointed to control or supervise any such examination, inspection, maintenance or test shall forthwith bring it to the attention of the relevant facility management who shall take appropriate action and ensure the matter is then notified, recorded, investigated and reported in accordance with approved processes.

BM



### 23. Decommissioning

- a. The licensee must implement NNR approved processes for the decommissioning of facilities or any part thereof on the site.
- b. The Licensee must submit for approval a decommissioning plan, as early as possible in the life cycle of the activity or facility. The plan should be revisited and updated as necessary.
- c. A detailed decommissioning plan must be submitted to the NNR for approval prior to the commencement of decommissioning activities.
- d. It must be demonstrated to the NNR that sufficient resources will be available from the time of cessation of operations until termination of the period of responsibility.
- e. Where appropriate decommissioning may be divided into stages. If so specified by the NNR, the licensee may not commence with nor proceed from one stage of the decommissioning to the next without the prior approval of the NNR.
- f. The Licensee must establish and maintain a list of all contaminated areas on the site, which will require decontamination in the future.

### 24. Organizational Change

- a. The Licensee must implement NNR approved processes to control any change to its organizational structure or resources that may have a bearing on health, safety and the environment as contemplated in the Act.
- b. The processes must provide for the classification of changes to the organizational structure or resources according to their safety significance.
- c. The processes must include a requirement for the provision of documentation to justify the safety of the proposed change and shall where appropriate provide for the submission of such documentation to the NNR.

### 25. Financial Security

- a. The Licensee must annually provide proof to the NNR that any claim for compensation to an amount contemplated in Section 30(2) of the Act can be met.

BM.



## 26. Public Safety Information Forum

- a. In order to inform the persons living in the municipal area in respect of which an emergency plan has been established, in terms of Section 38(1) of the Act, on nuclear and radiation safety matters, the Licensee must establish a Public Safety Information Forum as prescribed.

## 27. Inspection Programme

- a. Pursuant to the provisions of Section 26(2) of the Act, the Licensee must implement an inspection programme to ensure compliance with all conditions of the nuclear installation licence.

## 28. Display of the Nuclear Installation Licence

- a. To ensure public access to the conditions specified in this licence, the Licensee must at all times display copies of this Nuclear Installation Licence at the entrance to the installation in the following languages – English, SeTswana and Afrikaans.
- b. The Licensee must provide to the NNR documented proof that the translations into SeTswana and Afrikaans are true and accurate translations of the original English text.

BM.



**PART B-1: SPECIFIED NNR REQUIREMENTS FOR THE TEST SMELTER**

B-1.1 Only non-contaminated scrap may be used in the cold commissioning of the Test smelter in Area 26.

B-1.2 The licensee must comply with the requirements, as per the NNR requirements documents, listed in the table below –

Document number	Description
RD-0014 (Rev 0)	Emergency Preparedness and Response Requirements for Nuclear Installations
RD-0016 (Rev 0)	Requirements for authorisation Submissions Involving Computer Software and Evaluation Models for Safety Calculations
RD-0024 (Rev 0)	Requirements on Risk Assessment and Compliance with Safety Criteria for Nuclear Installations
RD-0026 (Rev 0)	Decommissioning of Nuclear Facilities
RD-0034 (Rev 0)	Quality and Safety Management Requirements for Nuclear Installations
LD-1079 (Rev 1)	Requirements in Respect of Licence Change Requests to the National Nuclear Regulator

B-1.3 A maximum of 10 000kg of non-contaminated metal, melted metal or slag is allowed in the Test Smelter and storage areas for the Test Smelter.

B-1.4 The ventilation system must be operational during operations of the Test Smelter.

BM.



**PART B-2: SPECIFIED NNR REQUIREMENTS FOR THE AREA 26 CUTTING FACILITY**

B-2.1 Only equipment contaminated with uranium enriched in the  $^{235}\text{U}$  isotope to a level of <5% may be accepted for cutting in the Cutting Facility.

B-2.2 The licensee must comply with the requirements, as per the NNR requirements documents, listed in the table below –

Document number	Description
RD-0014 (Rev 0)	Emergency Preparedness and Response Requirements for Nuclear Installations
RD-0016 (Rev 0)	Requirements for authorisation Submissions Involving Computer Software and Evaluation Models for Safety Calculations
RD-0024 (Rev 0)	Requirements on Risk Assessment and Compliance with Safety Criteria for Nuclear Installations
RD-0026 (Rev 0)	Decommissioning of Nuclear Facilities
RD-0034 (Rev 0)	Quality and Safety Management Requirements for Nuclear Installations
LD-1079 (Rev 1)	Requirements in Respect of Licence Change Requests to the National Nuclear Regulator

B-2.3 Equipment for cutting in the Cutting Facility will only be accepted after it has been requested by the NFM for the Cutting Facility.

B-2.4 Equipment designated for and returning from the Cutting Facility will be stored in the storage area on the northern side of the Cutting Facility.

B-2.5 The equipment accepted for cutting will be divided and stored in demarcated storage areas for storage of “Feedstock”, “Waste” and “Packed Equipment”.

B-2.6 The storage block provided for “Feedstock” will be 2.5m wide and 10m long.

B-2.7 The storage block provided for “Packaged Equipment” will be 5m wide and 5m long.

B-2.8 The storage block provided for “Waste” will be 5m wide and 5m long.

B-2.9 Feedstock stored in the Cutting Facility feedstock storage block may not be stacked higher than 2m.

B-2.10 Packaged equipment stored in the Cutting Facility packaged equipment storage block may not be stacked higher than 1m.

BM.



B-2.11 Waste drums stored in the Cutting Facility waste storage block may not be stacked higher than 2 tiers.

B-2.12 Only one point of cutting will exist in the Cutting Facility at any one time.

B-2.13 Contamination removed from components will be collected in plastic bags and placed in either 100 litre or 160 litre waste drums.

B-2.14 Waste drums will contain a maximum of 200 g <sup>235</sup>U.

B-2.15 Floor wash water will be collected in 5 litre containers for evaporation.

B-2.16 An air change rate of least 5 air changes per hour will be maintained for operations in the Cutting Facility.

B-2.17 Monthly inspections must be performed at the storage areas to prevent accumulation of equipment or material and overflow of dedicated storage blocks.

B-2.18 Transfers of radioactive material or radioactively contaminated equipment from the facility to other facilities on the Palindaba site must comply with the requirements for on-site transfer and may only be undertaken to facilities that are appropriately authorized to receive said equipment and material.

B-2.19 No off-site transfer of radioactive material or radioactively contaminated equipment may be undertaken by the facility without prior NNR approval.

B-2.20 The maximum source term for the Cutting Facility in Area 26 is 4.43E11 Bq.

BM.

**PART B-3: SPECIFIED NNR REQUIREMENTS FOR THE SORTING AREA IN AREA 26**

- B-3.1 Only non-contaminated material for the cold commissioning of the Test Smelter may be sorted in this area.
- B-3.2 The licensee must comply with the requirements, as per the NNR requirements documents, listed in the table below –

Document number	Description
RD-0014 (Rev 0)	Emergency Preparedness and Response Requirements for Nuclear Installations
RD-0016 (Rev 0)	Requirements for authorisation Submissions Involving Computer Software and Evaluation Models for Safety Calculations
RD-0024 (Rev 0)	Requirements on Risk Assessment and Compliance with Safety Criteria for Nuclear Installations
RD-0026 (Rev 0)	Decommissioning of Nuclear Facilities
RD-0034 (Rev 0)	Quality and Safety Management Requirements for Nuclear Installations
LD-1079 (Rev 1)	Requirements in Respect of Licence Change Requests to the National Nuclear Regulator

- B-3.3 Sorting of non-contaminated items and components in this area is limited to feedstock for the Test Smelter.
- B-3.4 Transfers of radioactive material or radioactively contaminated equipment from the facility to other facilities on the Pelindaba site must comply with the requirements for on-site transfer and may only be undertaken to facilities that are appropriately authorized to receive said equipment and material.
- B-3.5 No off-site transfer of radioactive material or radioactively contaminated equipment may be undertaken by the facility without prior NNR approval.
- B-3.6 A maximum of 10 000kg of non-contaminated metal, melted metal or slag is allowed in the Test Smelter and storage areas for the Test Smelter.

BU.



#### PART B-4: SPECIFIED NNR REQUIREMENTS FOR SAFEGUARDS STORE

B-4.1 The licensee must comply with the requirements, as per the NNR requirements documents, listed in the table below –

Document number	Description
RD-0014 (Rev 0)	Emergency Preparedness and Response Requirements for Nuclear Installations
RD-0016 (Rev 0)	Requirements for authorisation Submissions Involving Computer Software and Evaluation Models for Safety Calculations
RD-0024 (Rev 0)	Requirements on Risk Assessment and Compliance with Safety Criteria for Nuclear Installations
RD-0026 (Rev 0)	Decommissioning of Nuclear Facilities
RD-0034 (Rev 0)	Quality and Safety Management Requirements for Nuclear Installations
LD-1079 (Rev 1)	Requirements in Respect of Licence Change Requests to the National Nuclear Regulator

B-4.2 The storage of equipment in the Safeguards Store in Area 26 is limited to eleven (11) ISO containers only.

B-4.3 Transfers of radioactive material or radioactively contaminated equipment from the facility to other facilities on the Pelindaba site must comply with the requirements for on-site transfer and may only be undertaken to facilities that are appropriately authorized to receive said equipment and material.

B-4.4 No off-site transfer of radioactive material or radioactively contaminated equipment may be undertaken by the facility without prior NNR approval.

BM

**PART B-5: SPECIFIED NNR REQUIREMENTS FOR THE AREA 26 PROCESS FLOOR**

B-5.1 The licensee must comply with the requirements, as per the NNR requirements documents, listed in the table below –

<b>Document number</b>	<b>Description</b>
RD-0014 (Rev 0)	Emergency Preparedness and Response Requirements for Nuclear Installations
RD-0016 (Rev 0)	Requirements for authorisation Submissions Involving Computer Software and Evaluation Models for Safety Calculations
RD-0024 (Rev 0)	Requirements on Risk Assessment and Compliance with Safety Criteria for Nuclear Installations
RD-0026 (Rev 0)	Decommissioning of Nuclear Facilities
RD-0034 (Rev 0)	Quality and Safety Management Requirements for Nuclear Installations
LD-1079 (Rev 1)	Requirements in Respect of Licence Change Requests to the National Nuclear Regulator

B-5.2 The storage of Mamba and Cheetah Motor Windings on the Area 26 Process Floor is limited to a maximum of one hundred and eleven (111) windings only.

B-5.3 The storage of Profan Motor Windings on the Area 26 Process Floor is limited to a maximum of twenty seven (27) windings only.

B-5.4 The storage of Heat Exchanger End Plates on the Area 26 Process Floor is limited to a maximum of seventy nine (79) end plates only.

B-5.5 The storage of Pallets with Heat Exchanger End Tubes on the Area 26 Process Floor is limited to a maximum of two (2) pallets only.

B-5.6 The storage of baskets with material on the Area 26 Process Floor is limited to a maximum of twenty nine (29) baskets only.

B-5.7 Transfers of radioactive material or radioactively contaminated equipment from the facility to other facilities on the Pelindaba site must comply with the requirements for on-site transfer and may only be undertaken to facilities that are appropriately authorized to receive said equipment and material.

B-5.8 No off-site transfer of radioactive material or radioactively contaminated equipment may be undertaken by the facility without prior NNR approval.

BM

**PART B-6: SPECIFIED NNR REQUIREMENTS FOR THE AREA 26 STORAGE AREA**

B-6.1 The licensee must comply with the requirements, as per the NNR requirements documents, listed in the table below –

<b>Document number</b>	<b>Description</b>
RD-0014 (Rev 0)	Emergency Preparedness and Response Requirements for Nuclear Installations
RD-0016 (Rev 0)	Requirements for authorisation Submissions Involving Computer Software and Evaluation Models for Safety Calculations
RD-0024 (Rev 0)	Requirements on Risk Assessment and Compliance with Safety Criteria for Nuclear Installations
RD-0026 (Rev 0)	Decommissioning of Nuclear Facilities
RD-0034 (Rev 0)	Quality and Safety Management Requirements for Nuclear Installations
LD-1079 (Rev 1)	Requirements in Respect of Licence Change Requests to the National Nuclear Regulator

B-6.2 The storage of Category “C” waste in 210 litre drums in the Area 26 Storage Area is limited to a maximum of forty five (45) 210 litre drums only.

B-6.3 The storage of Category “C” waste in 160 litre drums in the Area 26 Storage Area is limited to a maximum of thirty four (34) 160 litre drums only.

B-6.4 The storage of Category “C” waste in 100 litre drums in the Area 26 Storage Area is limited to a maximum of one (1) 100 litre drum only.

B-6.5 The storage of Category “C” waste in bags in the Area 26 Storage Area is limited to a maximum of ninety one (91) bags only.

B-6.6 The storage of material in crates in the Area 26 Storage Area is limited to a maximum of six (6) crates only.

B-6.7 Transfers of radioactive material or radioactively contaminated equipment from the facility to other facilities on the Pelindaba site must comply with the requirements for on-site transfer and may only be undertaken to facilities that are appropriately authorized to receive said equipment and material.

B-6.8 No off-site transfer of radioactive material or radioactively contaminated equipment may be undertaken by the facility without prior NNR approval.

BM.



B-6.9 Further decommissioning of the facility requires prior NNR approval which must be applied for under an Authorisation Change Request (ACR).

B-6.10 The facility must maintain a NNR approved care and maintenance programme.

BM.

Filed copy

**PART B-7: SPECIFIED NNR REQUIREMENTS FOR WORKSHOP 1 IN AREA 26**

B-7.1 The licensee must comply with the requirements, as per the NNR requirements documents, listed in the table below –

<b>Document number</b>	<b>Description</b>
RD-0014 (Rev 0)	Emergency Preparedness and Response Requirements for Nuclear Installations
RD-0016 (Rev 0)	Requirements for authorisation Submissions Involving Computer Software and Evaluation Models for Safety Calculations
RD-0024 (Rev 0)	Requirements on Risk Assessment and Compliance with Safety Criteria for Nuclear Installations
RD-0026 (Rev 0)	Decommissioning of Nuclear Facilities
RD-0034 (Rev 0)	Quality and Safety Management Requirements for Nuclear Installations
LD-1079 (Rev 1)	Requirements in Respect of Licence Change Requests to the National Nuclear Regulator

B-7.2 This workshop is currently not used, should this area be utilised for any other purpose this is subject to NNR approval which must be applied for under an ACR.

BM





**PART B-8: SPECIFIED NNR REQUIREMENTS FOR WORKSHOP 2 IN AREA 26**

B-8.1 The licensee must comply with the requirements, as per the NNR requirements documents, listed in the table below –

Document number	Description
RD-0014 (Rev 0)	Emergency Preparedness and Response Requirements for Nuclear Installations
RD-0016 (Rev 0)	Requirements for authorisation Submissions Involving Computer Software and Evaluation Models for Safety Calculations
RD-0024 (Rev 0)	Requirements on Risk Assessment and Compliance with Safety Criteria for Nuclear Installations
RD-0026 (Rev 0)	Decommissioning of Nuclear Facilities
RD-0034 (Rev 0)	Quality and Safety Management Requirements for Nuclear Installations
LD-1079 (Rev 1)	Requirements in Respect of Licence Change Requests to the National Nuclear Regulator

B-8.2 This workshop is currently not used, should this area be utilised for any other purpose this is subject to NNR approval which must be applied for under an ACR.

BM

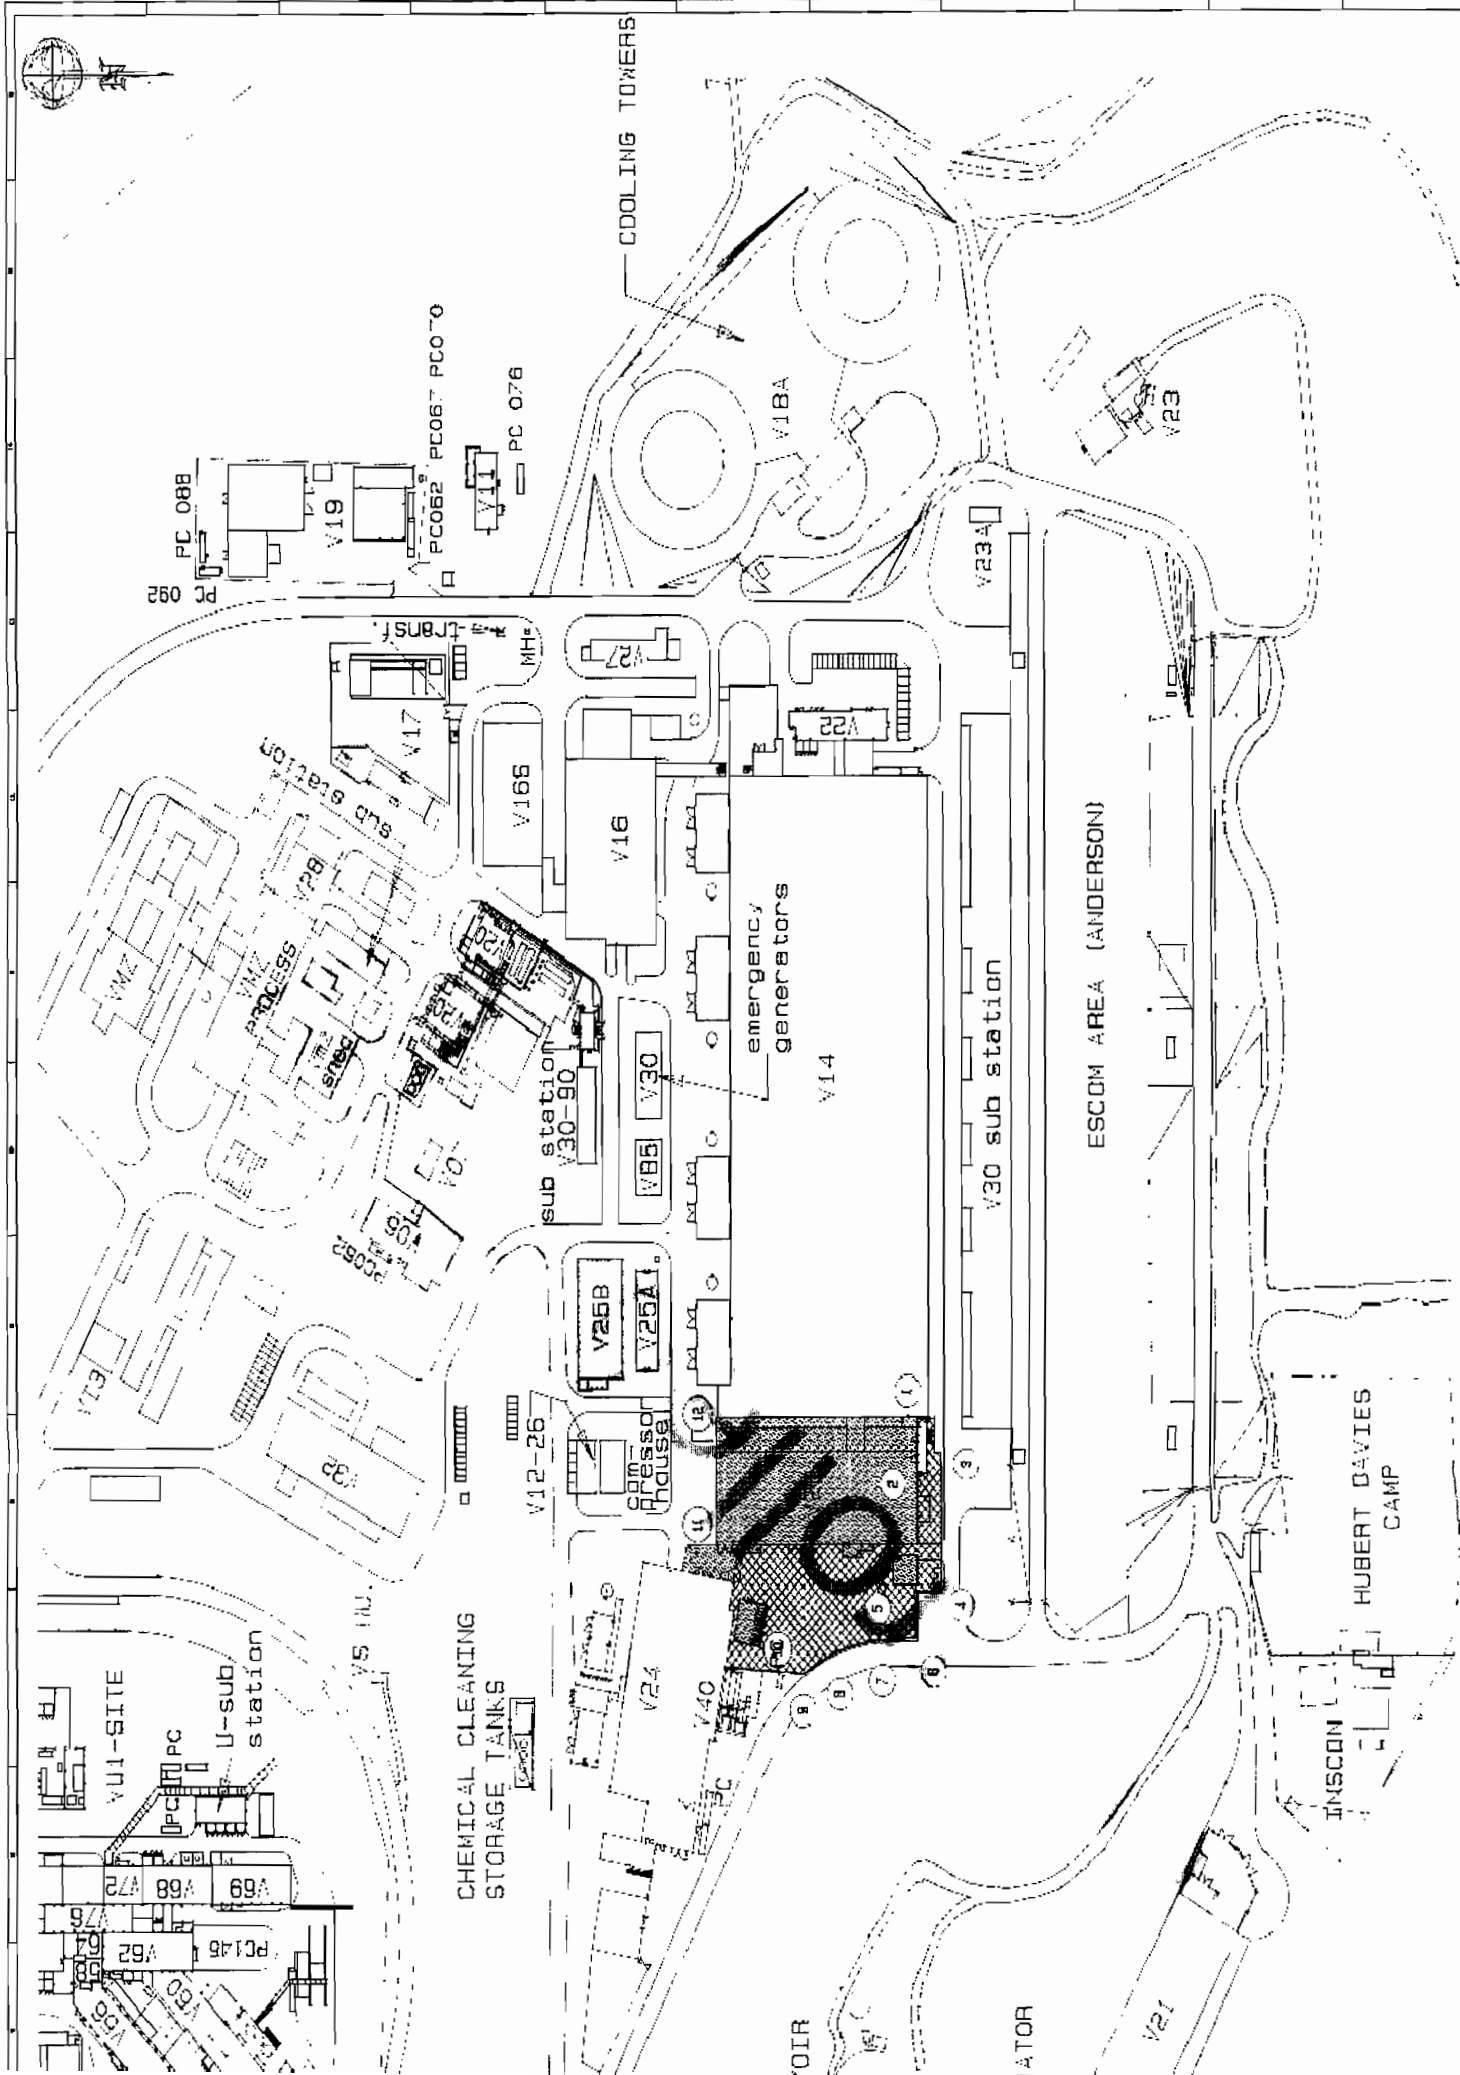

VUI-SITE  
U-sub station  
PC 088  
PC 092  
V69  
V70  
V71  
V72  
V73  
V74  
V75  
V76  
V77  
V78  
V79  
V80  
V81  
V82  
V83  
V84  
V85  
V86  
V87  
V88  
V89  
V90  
V91  
V92  
V93  
V94  
V95  
V96  
V97  
V98  
V99  
V100  
V101  
V102  
V103  
V104  
V105  
V106  
V107  
V108  
V109  
V110  
V111  
V112  
V113  
V114  
V115  
V116  
V117  
V118  
V119  
V120  
V121  
V122  
V123  
V124  
V125  
V126  
V127  
V128  
V129  
V130  
V131  
V132  
V133  
V134  
V135  
V136  
V137  
V138  
V139  
V140  
V141  
V142  
V143  
V144  
V145  
V146  
V147  
V148  
V149  
V150  
V151  
V152  
V153  
V154  
V155  
V156  
V157  
V158  
V159  
V160  
V161  
V162  
V163  
V164  
V165  
V166  
V167  
V168  
V169  
V170  
V171  
V172  
V173  
V174  
V175  
V176  
V177  
V178  
V179  
V180  
V181  
V182  
V183  
V184  
V185  
V186  
V187  
V188  
V189  
V190  
V191  
V192  
V193  
V194  
V195  
V196  
V197  
V198  
V199  
V200  
V201  
V202  
V203  
V204  
V205  
V206  
V207  
V208  
V209  
V210  
V211  
V212  
V213  
V214  
V215  
V216  
V217  
V218  
V219  
V220  
V221  
V222  
V223  
V224  
V225  
V226  
V227  
V228  
V229  
V230  
V231  
V232  
V233  
V234  
V235  
V236  
V237  
V238  
V239  
V240  
V241  
V242  
V243  
V244  
V245  
V246  
V247  
V248  
V249  
V250  
V251  
V252  
V253  
V254  
V255  
V256  
V257  
V258  
V259  
V260  
V261  
V262  
V263  
V264  
V265  
V266  
V267  
V268  
V269  
V270  
V271  
V272  
V273  
V274  
V275  
V276  
V277  
V278  
V279  
V280  
V281  
V282  
V283  
V284  
V285  
V286  
V287  
V288  
V289  
V290  
V291  
V292  
V293  
V294  
V295  
V296  
V297  
V298  
V299  
V300  
V301  
V302  
V303  
V304  
V305  
V306  
V307  
V308  
V309  
V310  
V311  
V312  
V313  
V314  
V315  
V316  
V317  
V318  
V319  
V320  
V321  
V322  
V323  
V324  
V325  
V326  
V327  
V328  
V329  
V330  
V331  
V332  
V333  
V334  
V335  
V336  
V337  
V338  
V339  
V340  
V341  
V342  
V343  
V344  
V345  
V346  
V347  
V348  
V349  
V350  
V351  
V352  
V353  
V354  
V355  
V356  
V357  
V358  
V359  
V360  
V361  
V362  
V363  
V364  
V365  
V366  
V367  
V368  
V369  
V370  
V371  
V372  
V373  
V374  
V375  
V376  
V377  
V378  
V379  
V380  
V381  
V382  
V383  
V384  
V385  
V386  
V387  
V388  
V389  
V390  
V391  
V392  
V393  
V394  
V395  
V396  
V397  
V398  
V399  
V400  
V401  
V402  
V403  
V404  
V405  
V406  
V407  
V408  
V409  
V410  
V411  
V412  
V413  
V414  
V415  
V416  
V417  
V418  
V419  
V420  
V421  
V422  
V423  
V424  
V425  
V426  
V427  
V428  
V429  
V430  
V431  
V432  
V433  
V434  
V435  
V436  
V437  
V438  
V439  
V440  
V441  
V442  
V443  
V444  
V445  
V446  
V447  
V448  
V449  
V450  
V451  
V452  
V453  
V454  
V455  
V456  
V457  
V458  
V459  
V460  
V461  
V462  
V463  
V464  
V465  
V466  
V467  
V468  
V469  
V470  
V471  
V472  
V473  
V474  
V475  
V476  
V477  
V478  
V479  
V480  
V481  
V482  
V483  
V484  
V485  
V486  
V487  
V488  
V489  
V490  
V491  
V492  
V493  
V494  
V495  
V496  
V497  
V498  
V499  
V500

CHEMICAL CLEANING STORAGE TANKS

V12-26

compressor house

V25B  
V25A1

sub station V30-90

V85  
V30

emergency generators  
V14

V30 sub station

ESCOM AREA (ANDERSON)

HUBERT DAVIES CAMP

INSCON CAMP

COOLING TOWERS

PC 088  
PC 092  
V19  
PC 062  
PC 067  
PC 070  
PC 076

V18A

V23

V23A

sub station

MH's

V27

V22

V13

V10

V17

V16

V16B

V17

V16

V16

V16

V16

V16

V16

V16

V16

V16

V16

V16

V16

V16

V16

V16

V16